



4184 E. Conant St.
Long Beach, CA 90808
Tel. 888-900-1002
Fax. 310-900-1088
www.turboairinc.net

Project :

Model # :

Item # :

Qty :

Approval :

Center Mount Cooler

Model : TCE156BE(OX, NX, OM, NM)



≡ FEATURES / BENEFITS ≡



Blue Anti-Corrosion
Hydrophobic Coated Fin.
Air Pass Guard for Better
Efficiency.



Inner Groove Copper Tube
for Maximum Coil Efficiency.
Mounted TXV, Solenoid,
Thermostat(Optional).

MODEL CAPACITY

- Air Defrost Coil: 5800(1 Fan) ~ 35600BTU(5 Fan)
- Electric Defrost Coil: 5800(1 Fan) ~ 35600BTU(5 Fan)

Center Mount Cooler

Model : TCE156BE(OX, NX, OM, NM)

TCE ELECTRIC DEFROST MODEL 60HZ WITH EC MOTOR (1 SPEED)

Capacity (R-404A)				Capacity (R-448A / R-449A)				Fan Data		
10°F / 6°C TD - 20°F / - 29°C SST		12°F / 7°C TD - 22°F / - 30°C SST		10°F / 6°C TD - 20°F / - 29°C SST		12°F / 7°C TD - 22°F / - 30°C SST		CFM/m³H		No.
BTUH	Watts	BTUH	Watts	BTUH	Watts	BTUH	Watts			
15793	4625	19490	5708	15675	4591	19336	5663	2240	3806	2

EC Motor Data			Defrost Heaters		Connections (Inches)				Approx. Net Weight (Lbs. / Kg)	AWEF Value	
230V 1Ph 60Hz			Watts	Total Amps	COIL INLET	SUCTION	EQUALIZER	DRAIN		R-404A	R-448A / R-449A
HP	Total Amps	Watts		230/1/60							
1/20	1.44	110	3020	13.1	1/2 OD	7/8 ID	1/4 OD	3/4 MPT	109 / 49	4.13	4.13

No. of Fans	Dimensions (Inches / mm)					
	A	B	C	D	E	F
2	79.3 (2015)	67.3 (1709.4)	33.6 (854.7)	-	9.2 (234.8)	10.4 (264.8)

Design and specifications subject to change without notice

TCE156BEOX: R404A TXV "SBFSE-B-Z" (Inlet: 3/8", Outlet: 1/2") Pre-installed

TCE156BENX: R448A/R449A TXV "SBFDE-A-Z" (Inlet: 3/8", Outlet: 1/2") Pre-installed



TCE156BEOM: R404A TXV "SBFSE-B-Z" (Inlet: 3/8", Outlet: 1/2") & LLSV "E5S130" (3/8") Pre-installed

TCE156BENM: R448A/R449A TXV "SBFDE-A-Z" (Inlet: 3/8", Outlet: 1/2") & LLSV "E5S130" (3/8") Pre-installed

■ **WARRANTY : 1 Year Fan Motor and Parts Warranty**

PLAN VIEW

(unit : inch)

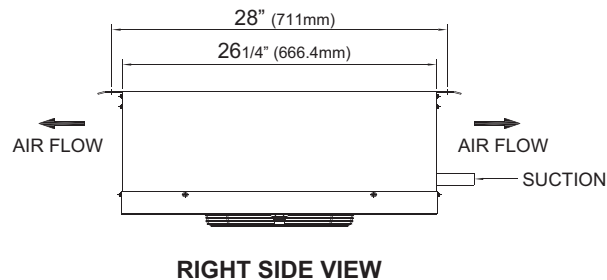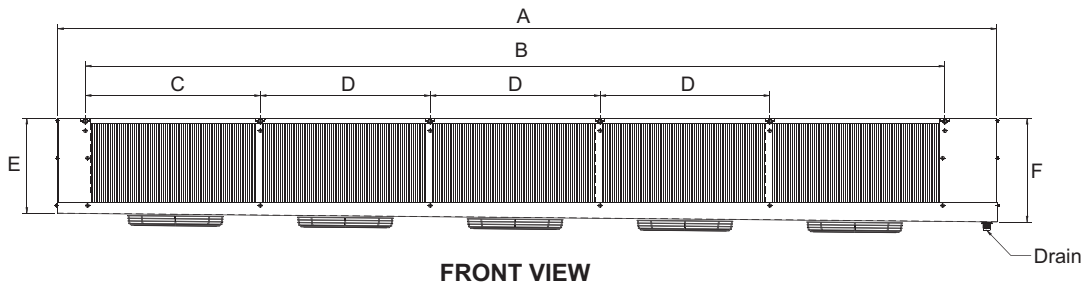

■ Toll Free: 888-900-1002



"Subject to change without notice" will allow Turbo Air to not be liable for small changes such as amperage, size or any other issue that someone would blame on us.